

**Lawrence Union Free School District**

**Districtwide Lead in Drinking Water  
Sampling and Remediation Plan**

**2020-2021**



**ENVIROSCIENCE**  
**CONSULTANTS INC.**

**2150 Smithtown Avenue  
Ronkonkoma, NY 11779  
(631) 580-3191  
[www.envirohealth.org](http://www.envirohealth.org)**

**Project #20585**

**Districtwide Lead in Drinking Water  
Sampling and Remediation Plan**

**Performed for:**

**Lawrence Union Free School District  
195 Broadway  
Lawrence, NY 11559**

**March 2021**

**Prepared by:**

**Enviroscience Consultants, Inc.  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779  
(631) 580-3191**

**Project #20585**

**President**



---

**Glenn Neuschwender**

# **Districtwide Lead in Drinking Water Sampling and Remediation Plan**

## **Table of Contents**

### **I. Executive Summary**

### **II. Sampling Methodology**

### **III. Initial Results**

#### **Appendix A – Lawrence High School**

#### **Appendix B – Lawrence Middle School**

#### **Appendix C – Lawrence School # 2**

#### **Appendix D – Lawrence School # 4**

March 12, 2021

Lance McAllister  
Lawrence UFSD  
195 Broadway  
Lawrence, NY 11559

## **I. Executive Summary**

The Lawrence Union Free School District has developed their 2020 Lead in Drinking Water Sampling and Analysis Program, as required by the New York State Department of Health (Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water).

In accordance with the regulation, this Lead Remediation Plan is prepared to identify locations deemed as Applicable Drinking Water Sources and report first draw sample results, to mitigate locations where sample results exceed 15 parts per billion, to identify locations deemed as Non-Applicable Water Sources, communicate this designation to building occupants, and to develop strategies for monitoring locations deemed Non-Applicable Water Sources to insure building occupants do not consume water from these locations.

Within the Lawrence Union Free School District, the following locations have been deemed Applicable Drinking Water Sources by the administration:

- 1) Water fountains and bottle filling stations;
- 2) Kitchen water faucets and pot fillers used in food preparation;
- 3) Ice machines
- 4) Elementary School classroom sinks
- 5) Elementary School bathroom sinks

First draw samples were collected from each of these locations within the District, and analyzed by a New York State Department of Health ELAP certified laboratory. For results at or below 15 ppb, no further action is required until 2025. For locations above 15 ppb, options include: second and third draw sample collection to determine source of lead, designation of the location as Non-applicable Water Source, or permanent removal of the fixture from the location. In either case, the result was communicated by Enviroscience Consultants, and the fixture was shut off by the District immediately upon receipt of results.

The following locations within the Lawrence Union Free School District were deemed Non-Applicable Water Sources by the administration:

- 1) Science Laboratory sinks;
- 2) Art Room sinks;
- 3) Other classroom sinks;
- 4) Other Bathroom sinks;
- 5) Outside spigots
- 6) Custodial Closet sinks

In these cases, the District has placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks - communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Art Room sinks - communicate in writing to students that these locations are for cleaning of art supplies and hand washing only, not for consumption. This is most easily accomplished by including this language in the course paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective art teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Other classroom sinks - classrooms in this category often include elementary classrooms, where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 4) Other bathroom sinks - in intermediate buildings, signage should be sufficient for communicating the concept of hand washing only. In elementary schools, personal hygiene should be integrated into curriculum to ensure students understand bathroom sinks are for hand washing only, and not consumption. Further, show what the signage looks like in bathrooms so they learn to recognize its meaning. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 5) Outside spigots - all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 6) Custodial Closet sinks - these locations should be accessed by custodial personnel only, and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

## II. Sampling Procedures:

In accordance with the regulation, EnviroScience Consultants, Inc. performed initial water sampling throughout the Lawrence Union Free School District on March 2 and 3, 2021. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours before the facilities opened. The water sources were not used for at least 8 hours and not more than 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes and the sampling location schematics are shown below.

### Fixture Type Codes

BF Bottle Filler  
 HB Hose Bib  
 IM Ice Machine  
 OS Other Source  
 PF Pot Filler  
 SK Sink  
 SL Supply Line  
 SP Spigot  
 SPY Spray  
 SS Slop Sink  
 V Valve  
 WC Water Cooler  
 WF Water Fountain


### Source Designations

App Applicable  
 N/A Non-applicable

### Remediation Type Codes

FR Fixture Replacement  
 FRSLV Fixture, supply line or valve replacement  
 FRSLVPA Fixture, supply line or valve replacement plumbing assessment  
 SIGN Non-potable water sign posted  
 CAPPED Supply line capped or fixture removed

## Sampling Location Schematics

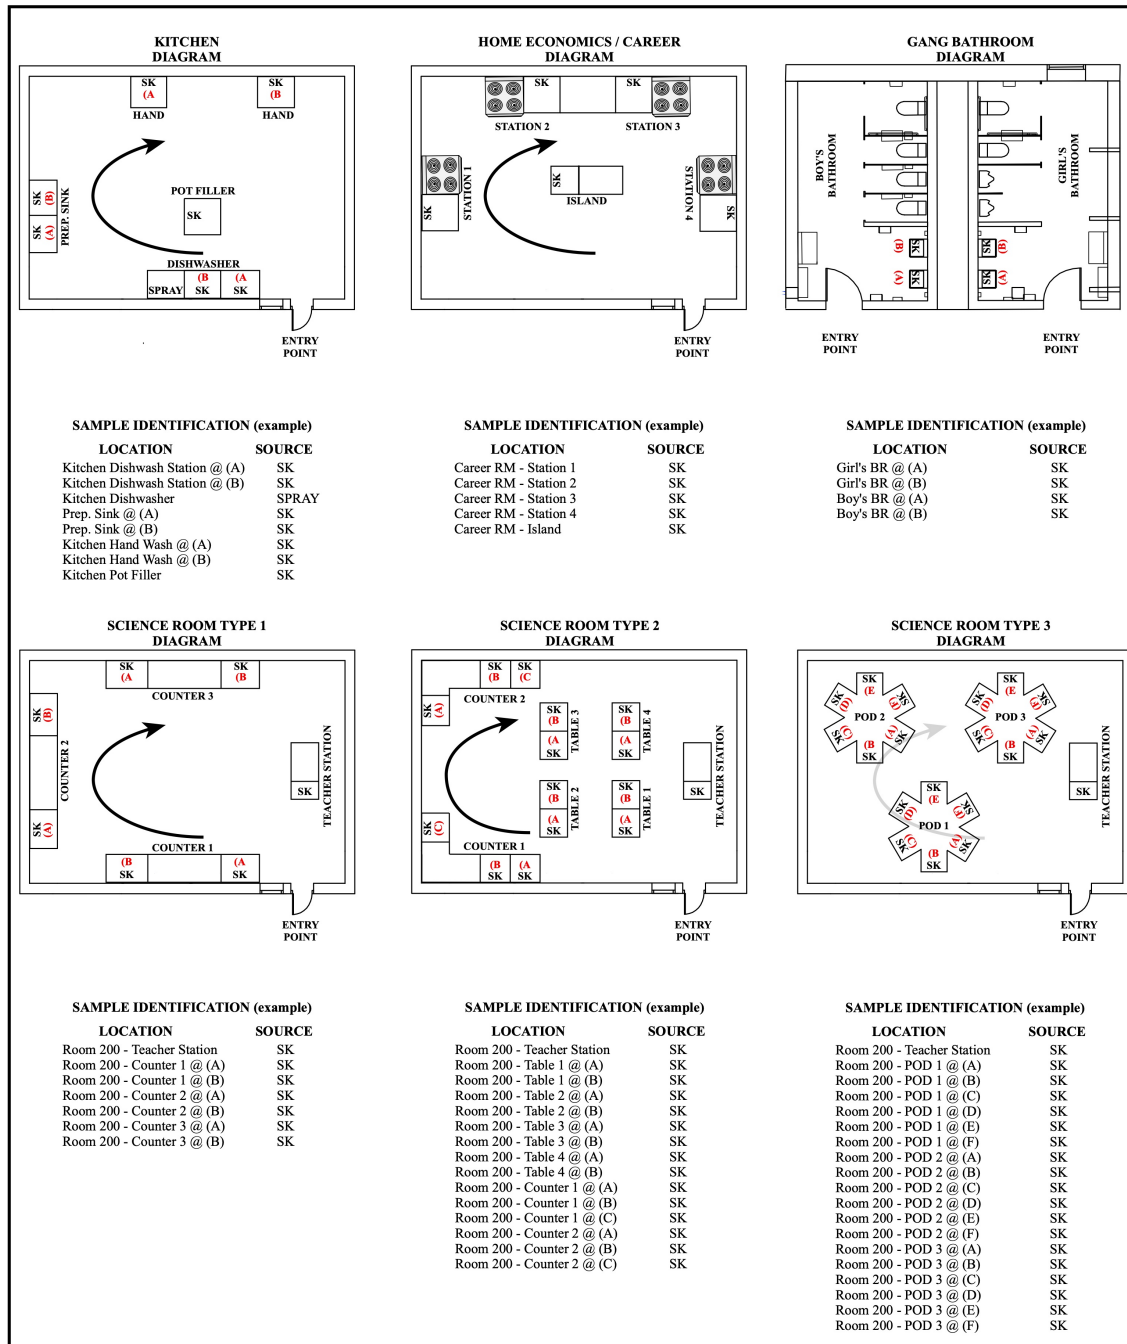

### III. Initial Results:

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered Non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at Non-applicable sources is documented in the School Water Outlet Inventory for each building (Appendix A through D).

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested before returning to service. All locations deemed non-applicable, but do not have signs, should be taken off line until signs have been posted.

The following is a summary of results in parts per billion (ppb) of locations where sample results were found above 15 ppb:

#### Lawrence High School

Girl's Locker Room Coach's Office Bathroom	SK	22.8
Girl's Locker Room Bathroom @ C	SK	32.5
Boy's Locker Room Bathroom @ A	SK	31.4
Room 136 Nursing Class - left	SK	17.7
Room 136 Nursing Class - right	SK	15.8
Art Suite Vestibule	WF	58.5
Nurse's Office by Filing Cabinet	SK	15.5
Room 155A Office	SK	21.5
Room 220 by Laundry	SK	31.2
1st Football Locker Room Bathroom - Left	SK	52.4
1st Football Locker Room Bathroom - Right	SK	22.6
2nd Football Locker Room	WF	30.6
2nd Football Locker Room Bathroom - Left	SK	25.6



## Lawrence Middle School

Room 138-Counter @C	SPY	31.4
Room 117A	SK	17.5
Room 117A Bathroom	SK	15.9
Hallway by Room 223	WF	139
Room 302-Prep Room-Left	SK	35.8
Room 302-Prep Room-Right	SK	63.9
Special Education Room 351	SK	19.6

## Lawrence School #2

Basement Girl's Bathroom - Left	SK	22.1
Basement Girl's Bathroom - Right	SK	17.6
Basement Boy's Bathroom - Left	SK	31.7
Room B9 - Left	SK	28.7
Room B9 - Right	SK	25.6
Hall by Basement Faculty Bathroom	WF	23.7
Boy's Bathroom by Room 3	SK	21.9
Girl's Bathroom by Room 1	SK	20.8
Room 3	SK	17.5
Boy's Bathroom by Room 12	SK	57.8
Girl's Bathroom by Room 12	SK	18.6
Room 30 Bathroom - Left	SK	40.6
Room 30 Bathroom - Middle	SK	65.1
Room 30 Bathroom - Right	SK	71.8
Music Room Bathroom	SK	51.5
Men's Bathroom by Gym Lobby - Left	SK	17.2
Men's Bathroom by Gym Lobby - Right	SK	28.7
Women's Bathroom by Gym Lobby - Left	SK	15.7
Girl's Bathroom by Room 102 - Left	SK	18.1
Girl's Bathroom by Room 102 - Right	SK	43
Room 102	SK	16

Boy's Bathroom by Room 17	SK	21.9
Girl's Bathroom by Room 15	SK	20.8
Boy's Bathroom by Room 26	SK	39.5
Girl's Bathroom by Room 26	SK	25.2

#### **Lawrence School #4**

Room B13	SK	42.3
Girl's Bathroom by Cafeteria - Left	SK	28.3
Pre-K Lunch Room	SK	26.7
Unisex Bathroom by Pre-K Lunch Room - Left	SK	29.6
Unisex Bathroom by Pre-K Lunch Room - Right	SK	15.7
Room B9 - Right	SK	23.3
Room 14	WF	72
Room 12	SK	28.1
Room 9	WF	17.6
Nurse's Office Bathroom	SK	36.4
Room 5 Bathroom	SK	83
Room 4	SK	43.4
Room 24 Bathroom	SK	22.1
Room 19 Bathroom	SK	45.4

## Appendix A

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-01	Kitchen Handwash @ A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1001-02	Kitchen Sanitizer @ A	SK	App	5.6	3/2/2021	-	-	-	None	-	-	-
1001-03	Kitchen Sanitizer @ B	SK	App	6.25	3/2/2021	-	-	-	None	-	-	-
1001-04	Kitchen Hoshizaki	IM	App	<1.0	3/2/2021	-	-	-	None	-	-	-
1001-05	Kitchen Ice-O-Matic	IM	App	<1.0	3/2/2021	-	-	-	None	-	-	-
1001-06	Kitchen 2-Bay @ A	SK	App	12	3/2/2021	-	-	-	None	-	-	-
1001-07	Kitchen 2-Bay @ B	SK	App	10.8	3/2/2021	-	-	-	None	-	-	-
1001-08	Kitchen Handwash @ B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1001-09	Kitchen Island	SK	App	9.49	3/2/2021	-	-	-	None	-	-	-
1001-10	Kitchen Bathroom	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
1001-11	Kitchen Custodial Closet	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1001-12	Kitchen Locker Room Bathroom	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1001-13	Kitchen Storage	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1002-01	Men's Bathroom by Gym - Left	SK	App	2.43	3/2/2021	-	-	-	None	-	-	-
1002-02	Men's Bathroom by Gym - Right	SK	App	5.23	3/2/2021	-	-	-	None	-	-	-
1003-01	Unisex Bathroom by Gym	SK	App	2.78	3/2/2021	-	-	-	None	-	-	-
1004-01	Girl's Locker Room Coach's Office Bathroom	SK	App	22.8	3/2/2021				Additional Sampling Required			
1004-02	Girl's Locker Room	WF	App		3/2/2021	-	-	-	None	Removed From Service	-	-
1004-03	Girl's Locker Room Bathroom @ A	SK	App	11.7	3/2/2021	-	-	-	None	-	-	-
1004-04	Girl's Locker Room Bathroom @ B	SK	App	6.26	3/2/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1004-05	Girl's Locker Room Bathroom @ C	SK	App	32.5	3/2/2021				Additional Sampling Required			
1005-01	Hall by Cafeteria	WF	App	<1.0	3/2/2021	-	-	-	None	-	-	-
1005-02	Hall by Cafeteria	BF	App	<1.0	3/2/2021	-	-	-	None	-	-	-
1006-01	Hall by Boy's Locker Room	WF	App	<1.0	3/2/2021	-	-	-	None	-	-	-
1006-02	Hall by Boy's Locker Room	WF	App	<1.0	3/2/2021	-	-	-	None	-	-	-
1007-01	Boy's Locker Room Custodial Closet	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1007-02	Boy's Locker Room Coach's Office Bathroom	SK	App	1.43	3/2/2021	-	-	-	None	-	-	-
1007-03	Boy's Locker Room	WF	App		3/2/2021	-	-	-	None	Removed From Service	-	-
1007-04	Boy's Locker Room Bathroom @ A	SK	App	31.4	3/2/2021				Additional Sampling Required			
1007-05	Boy's Locker Room Bathroom @ B	SK	App		3/2/2021	-	-	-		Removed From Service	-	-
1008-01	Old Custodial Office	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1008-02	Old Custodial Office Bathroom	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1009-01	Athletic Office	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1010-01	Room 136 Nursing Class - Left	SK	App	17.7	3/2/2021				Additional Sampling Required			
1010-02	Room 136 Nursing Class - Right	SK	App	15.8	3/2/2021				Additional Sampling Required			
1011-01	Art Suite Vestibule	WF	App	58.5	3/2/2021				Additional Sampling Required			
1011-02	Art Suite Room 134 Unit @ A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1011-03	Art Suite Room 134 Unit @ B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1011-04	Art Suite Room 134 Unit @ C	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1012-01	Room 132	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1013-01	Nurse's Office	SK	App	7.2	3/2/2021	-	-	-	None	-	-	-
<b>1013-02</b>	<b>Nurse's Office by Filing Cabinet</b>	<b>SK</b>	<b>App</b>	<b>15.5</b>	<b>3/2/2021</b>				<b>Additional Sampling Required</b>			
1013-03	Nurse's Office Bathroom	SK	App	5.14	3/2/2021	-	-	-	None	-	-	-
1014-01	Room 128 Unit @ A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1014-02	Room 128 Unit @ B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1014-03	Room 128 Unit @ C	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1014-04	Room 128A Unit @ A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1014-05	Room 128A Unit @ B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1014-06	Room 128A Unit @ C	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1014-07	Room 128A Unit @ D	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1015-01	Room 127	SK	App	7.62	3/2/2021	-	-	-	None	-	-	-
1015-02	Room 127	WF	App		3/2/2021	-	-	-	None	Removed From Service	-	-
1015-03	Room 127C Life Skills	SK	App	5.92	3/2/2021	-	-	-	None	-	-	-
1016-01	Hall by Room 127	WF	App		3/2/2021	-	-	-	None	Removed From Service	-	-
1017-01	Room 125 Bathroom	SK	App		3/2/2021	-	-	-		Removed From Service	-	-
1017-02	Room 125	WF	App	2.24	3/2/2021	-	-	-	None	-	-	-
1018-01	Custodial Office Bathroom	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1018-02	Custodial Office @ A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1018-03	Custodial Office @ B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1018-04	Custodial Office Kitchen	SK	N/A		3/2/2021	-	-	-	Sampling Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1019-01	Room 122 Science Prep	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1020-01	Room 121 Teacher's Station	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1020-02	Room 121 Counter	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1021-01	Room 120A Science Prep	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1022-01	Hall by Room 120	WF	App		3/2/2021	-	-	-	None	Removed From Service	-	-
1023-01	Room 120 Teacher's Station	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1023-02	Room 120 @ A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1023-03	Room 120 @ B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1023-04	Room 120 @ C	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1023-05	Room 120 @ D	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1023-06	Room 120 @ E	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1023-07	Room 120 @ F	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1024-01	Room 119 Teacher's Station	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1024-02	Room 119 @ A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1024-03	Room 119 @ B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1024-04	Room 119 @ C	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1024-05	Room 119 @ D	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1024-06	Room 119 @ E	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1024-07	Room 119 @ F	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1024-08	Room 119 @ G	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1024-09	Room 119 Fume Hood	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1025-01	Room 118 Teacher's Station	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1025-02	Room 118 @ A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1025-03	Room 118 @ B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1025-04	Room 118 @ C	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1025-05	Room 118 @ D	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1025-06	Room 118 @ E	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1025-07	Room 118 @ F	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1026-01	Room 118A Science Prep	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1027-01	Room 117 Teacher's Station	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1027-02	Room 117 @ A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1027-03	Room 117 @ B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1027-04	Room 117 @ C	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1027-05	Room 117 @ D	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1027-06	Room 117 @ E	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1027-07	Room 117 @ F	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1028-01	Room 116 Teacher's Station	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1028-02	Room 116 @ A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1028-03	Room 116 @ B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1028-04	Room 116 @ C	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1028-05	Room 116 @ D	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1028-06	Room 116 @ E	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1028-07	Room 116 @ F	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1029-01	Hall by Room 117	WF	App		3/2/2021	-	-	-	None	Removed From Service	-	-
1030-01	Room 113 Teacher's Station	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1030-02	Room 113 @ A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1030-03	Room 113 @ B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1030-04	Room 113 @ C	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1030-05	Room 113 @ D	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1030-06	Room 113 @ E	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1030-07	Room 113 @ F	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1031-01	Room 112 Teacher's Station	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1032-01	Boy's Bathroom by Room 108 @ A	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1032-02	Boy's Bathroom by Room 108 @ B	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1032-03	Boy's Bathroom by Room 108 @ C	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1032-04	Boy's Bathroom by Room 108 @ D	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1033-01	Custodial Closet by Room 108	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1034-01	Room 107 Teacher's Station	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1035-01	Room 105 Teacher's Station	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1036-01	Room 103 Teacher's Station	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1037-01	Room 101 Teacher's Station	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1038-01	Hall by Room 101	WF	App		3/2/2021	-	-	-	None	Removed From Service	-	-
1039-01	Unisex Bathroom by Main Office	SK	App	<1.0	3/2/2021	-	-	-	None	-	-	-
1040-01	Girl's Bathroom by District Office Unit @ A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1040-02	Girl's Bathroom by District Office Unit @ B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1041-01	Custodial Closet by District Office	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1042-01	District Office Faculty Room	SK	App	2.09	3/2/2021	-	-	-	None	-	-	-
1042-02	District Office Faculty Room	SPY	App	<1.0	3/2/2021	-	-	-	None	-	-	-
1042-03	District Office Bathroom	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1043-01	Unisex Bathroom by Auditorium	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1044-01	Room 153 Band Office	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
<b>1045-01</b>	<b>Room 155A Office</b>	<b>SK</b>	<b>App</b>	<b>21.5</b>	<b>3/2/2021</b>				<b>Additional Sampling Required</b>			
1046-01	Stage Crew Storage	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1047-01	Unisex Bathroom by Room 123 @ A	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1047-02	Unisex Bathroom by Room 123 @ B	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1048-01	Room 147 Teacher's Station	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1048-02	Room 147 @ A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1048-03	Room 147 @ B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1048-04	Room 147 @ C	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1048-05	Room 147 @ D	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1048-06	Room 147 @ E	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1048-07	Room 147 Fume Hood	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1049-01	Girl's Bathroom by Room 147 @ A	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1049-02	Girl's Bathroom by Room 147 @ B	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1049-03	Girl's Bathroom by Room 147 @ C	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1049-04	Girl's Bathroom by Room 147 @ D	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1049-05	Girl's Bathroom by Room 147 @ E	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1049-06	Girl's Bathroom by Room 147 @ F	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1050-01	Custodial Closet by Room 147	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
2001-01	Unisex Bathroom by Room 227	SK	App	12.9	3/2/2021	-	-	-	None	-	-	-
2002-01	Hall by Room 223	WF	App		3/2/2021	-	-	-	None	Removed From Service	-	-
<b>2003-01</b>	<b>Room 220 by Laundry</b>	<b>SK</b>	<b>App</b>	<b>31.2</b>	<b>3/2/2021</b>				<b>Additional Sampling Required</b>			
2003-02	Room 220 Station 1	SK	App	2.31	3/2/2021	-	-	-	None	-	-	-
2003-03	Room 220 Station 2	SK	App	14.7	3/2/2021	-	-	-	None	-	-	-
2003-04	Room 220 Station 3	SK	App	7.94	3/2/2021	-	-	-	None	-	-	-
2003-05	Room 220 Station 4	SK	App	7.73	3/2/2021	-	-	-	None	-	-	-
2003-06	Room 220 Station 5	SK	App	10.4	3/2/2021	-	-	-	None	-	-	-
2004-01	Room 218	SK	App	6.59	3/2/2021	-	-	-	None	-	-	-
2004-02	Room 218	SPY	App	4.85	3/2/2021	-	-	-	None	-	-	-
2005-01	Faculty Room 217 Women's Bathroom - Left	SK	App	5.31	3/2/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2005-02	Faculty Room 217 Women's Bathroom - Right	SK	App	1.79	3/2/2021	-	-	-	None	-	-	-
2006-01	Men's Faculty Bathroom by Room 216	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
2007-01	Hall by Room 212	WF	App		3/2/2021	-	-	-	None	Removed From Service	-	-
2008-01	Boy's Bathroom by Room 210 @ A	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2008-02	Boy's Bathroom by Room 210 @ B	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2009-01	Custodial Closet by Room 210	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
2010-01	Room 204	SK	App	6.94	3/2/2021	-	-	-	None	-	-	-
2011-01	Hall by Room 201	WF	App		3/2/2021	-	-	-	None	Removed From Service	-	-
2012-01	Hall by Room 242	WF	App	2.05	3/2/2021	-	-	-	None	-	-	-
2013-01	Girl's Bathroom by Room 242 @ A	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2013-02	Girl's Bathroom by Room 242 @ B	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2014-01	Custodial Closet by Room 242	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
2015-01	Custodial Closet by Football Locker Room	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
2016-01	1st Football Locker Room	WF	App		3/2/2021	-	-	-	None	Removed From Service	-	-
2016-02	1st Football Locker Room Bathroom - Left	SK	App	52.4	3/2/2021				Additional Sampling Required			
2016-03	1st Football Locker Room Bathroom - Right	SK	App	22.6	3/2/2021				Additional Sampling Required			
2017-01	Football Locker Room Coach's Office Bathroom	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
2017-02	Football Locker Room Coach's Office	IM	App	1.54	3/2/2021	-	-	-	None	-	-	-
2018-01	2nd Football Locker Room	WF	App	30.6	3/2/2021				Additional Sampling Required			
2018-02	2nd Football Locker Room Bathroom - Left	SK	App	25.6	3/2/2021				Additional Sampling Required			

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2018-03	2nd Football Locker Room Bathroom - Right	SK	App		3/2/2021	-	-	-	None	Removed From Service	-	-
2019-01	Custodial Closet by Wrestling Room	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
2020-01	Wrestling Room Bathroom	SK	App	13.5	3/2/2021	-	-	-	None		-	-
3001-01	Hall by Room 339	WF	App		3/2/2021	-	-	-	None	Removed From Service	-	-
3002-01	Girl's Bathroom by Room 336 @ A	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
3002-02	Girl's Bathroom by Room 336 @ B	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
3003-01	Custodial Closet by Room 336	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
3004-01	Hall by Room 329	WF	App		3/2/2021	-	-	-	None	Removed From Service	-	-
3005-01	Faculty Room 321 Men's Bathroom	SK	App	1.83	3/2/2021	-	-	-	None	-	-	-
3006-01	Women's Faculty Bathroom by Room 319	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
3007-01	Hall by Room 318	WF	App		3/2/2021	-	-	-	None	Removed From Service	-	-
3008-01	Hall by Room 315	WF	App	3.56	3/2/2021	-	-	-	None	-	-	-
3009-01	Boy's Bathroom by Room 313 @ A	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
3009-02	Boy's Bathroom by Room 313 @ B	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
3010-1	Custodial Closet by Room 313	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
3011-1	Hall by Room 301	WF	App		3/2/2021	-	-	-	None	Removed From Service	-	-

## Laboratory Report

NYE Report #: 2210882-17077

March 8, 2021

Project Manager  
Enviroscience Consultants, Inc.  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779

Project: Lawrence High School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on March 04, 2021. New York Environmental analyzed the samples on March 05, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	02 Mar 2021
Date Received:	04 Mar 2021
Date Analyzed:	05 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210304N135	1	Kitchen Sanitizer @ A-SK; Initial	1.00	5.60	µg/L	
210304N136	2	Kitchen Sanitizer @ B-SK; Initial	1.00	6.25	µg/L	
210304N137	3	Kitchen Hoshizaki-IM; Initial	1.00	<1.00	µg/L	
210304N138	4	Kitchen Ice-O-Matic-IM; Initial	1.00	<1.00	µg/L	
210304N139	5	Kitchen 2-Bay @ A-SK; Initial	1.00	12.0	µg/L	
210304N140	6	Kitchen 2-Bay @ B-SK; Initial	1.00	10.8	µg/L	
210304N141	7	Kitchen Island-SK; Initial	1.00	9.49	µg/L	
210304N142	8	Men's Bathroom by Gym @ A-SK; Initial	1.00	2.43	µg/L	
210304N143	9	Men's Bathroom by Gym @ B-SK; Initial	1.00	5.23	µg/L	
210304N144	10	Unisex Bathroom by Gym-SK; Initial	1.00	2.78	µg/L	
210304N145	11	Girl's Locker Room Coach's Office Bathroom-SK; Initial	1.00	22.8	µg/L	H
210304N146	12	Girl's Locker Room Bathroom @ A-SK; Initial	1.00	11.7	µg/L	
210304N147	13	Girl's Locker Room Bathroom @ B-SK; Initial	1.00	6.26	µg/L	
210304N148	14	Girl's Locker Room Bathroom @ C-SK; Initial	1.00	32.5	µg/L	H
210304N149	15	Hall by Cafeteria-WF; Initial	1.00	<1.00	µg/L	
210304N150	16	Hall by Cafeteria-BF; Initial	1.00	<1.00	µg/L	
210304N151	17	Hall by Boy's Locker Room-WF; Initial	1.00	<1.00	µg/L	
210304N152	18	Hall by Boy's Locker Room-WF; Initial	1.00	<1.00	µg/L	
210304N153	19	Boy's Locker Room Coach's Office Bathroom-SK; Initial	1.00	1.43	µg/L	
210304N154	20	Boy's Locker Room Bathroom @ A-SK; Initial	1.00	31.4	µg/L	H
210304N155	21	Room 136 Nursing Class - Right-SK; Initial	1.00	15.8	µg/L	H
210304N156	22	Room 136 Nursing Class - Left-SK; Initial	1.00	17.7	µg/L	H
210304N157	23	Art Suite Vestibule-WF; Initial	1.00	58.5	µg/L	E,H
210304N158	24	Nurse's Office-SK; Initial	1.00	7.20	µg/L	
210304N159	25	Nurse's Office by Filing Cabinet-SK; Initial	1.00	15.5	µg/L	H
210304N160	26	Nurse's Office Bathroom-SK; Initial	1.00	5.14	µg/L	

Date Collected:	02 Mar 2021
Date Received:	04 Mar 2021
Date Analyzed:	05 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210304N161	27	Room 127-SK; Initial	1.00	7.62	µg/L	
210304N162	28	Room 127C Life Skills-SK; Initial	1.00	5.92	µg/L	
210304N163	29	Room 125-WF; Initial	1.00	2.24	µg/L	
210304N164	30	Unisex Bathroom by Main Office-SK; Initial	1.00	<1.00	µg/L	
210304N165	31	District Office Faculty Room-SK; Initial	1.00	2.09	µg/L	
210304N166	32	District Office Faculty Room-SPY; Initial	1.00	<1.00	µg/L	
210304N167	33	Room 155A Office-SK; Initial	1.00	21.5	µg/L	H
210304N168	34	Unisex Bathroom by Room 227-SK; Initial	1.00	12.9	µg/L	
210304N169	35	Room 220 by Laundry-SK; Initial	1.00	31.2	µg/L	H
210304N170	36	Room 220 Station 1-SK; Initial	1.00	2.31	µg/L	
210304N171	37	Room 220 Station 2-SK; Initial	1.00	14.7	µg/L	
210304N172	38	Room 220 Station 3-SK; Initial	1.00	7.94	µg/L	
210304N173	39	Room 220 Station 4-SK; Initial	1.00	7.73	µg/L	
210304N174	40	Room 220 Station 5-SK; Initial	1.00	10.4	µg/L	
210304N175	41	Room 218-SK; Initial	1.00	6.59	µg/L	
210304N176	42	Room 218-SPY; Initial	1.00	4.85	µg/L	
210304N177	43	Faculty Room 217 Women's Bathroom - Left-SK; Initial	1.00	5.31	µg/L	
210304N178	44	Faculty Room 217 Women's Bathroom - Right-SK; Initial	1.00	1.79	µg/L	
210304N179	45	Room 204-SK; Initial	1.00	6.94	µg/L	
210304N180	46	Hall by Room 242-WF; Initial	1.00	2.05	µg/L	
210304N181	47	Faculty Room 321 Men's Bathroom -SK; Initial	1.00	1.83	µg/L	
210304N182	48	Hall by Room 315-WF; Initial	1.00	3.56	µg/L	
210304N183	49	1st Football Locker Room Bathroom - Left-SK; Initial	1.00	52.4	µg/L	E,H
210304N184	50	1st Football Locker Room Bathroom - Right-SK; Initial	1.00	22.6	µg/L	H
210304N185	51	Football Locker Room Coach's Office-IM; Initial	1.00	1.54	µg/L	
210304N186	52	2nd Football Locker Room Bathroom - Left-SK; Initial	1.00	25.6	µg/L	H
210304N187	53	2nd Football Locker Room-WF; Initial	1.00	30.6	µg/L	H



Date Collected:	02 Mar 2021
Date Received:	04 Mar 2021
Date Analyzed:	05 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210304N188	54	Wrestling Room Bathroom-SK; Initial	1.00	13.5	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

## Appendix B

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen	SK	App			-	-	-	Sampling Required	ONGOING RENOVATION	-	-
1002-1	Cafeteria B	WF	App			-	-	-	Sampling Required	ONGOING RENOVATION	-	-
1003-1	Cafeteria A	WF	App			-	-	-	Sampling Required	ONGOING RENOVATION	-	-
1004-1	Boy's Bathroom by Cafeteria A @A	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1004-2	Boy's Bathroom by Cafeteria A @B	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1004-3	Boy's Bathroom by Cafeteria A @C	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1004-4	Boy's Bathroom by Cafeteria A @D	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1004-5	Boy's Bathroom by Cafeteria A @E	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1005-1	Custodial Closet by Cafeteria A	SS	N/A		3/2/2021	-	-	-	None	LOCKED DOOR	-	-
1006-1	Hallway by Cafeteria A	WF	N/A		3/2/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1006-2	Hallway by Cafeteria A	BF	N/A		3/2/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1007-1	LES Bathroom	SK	App	3.7	3/2/2021	-	-	-	None	-	-	-
1008-1	Nurse's Office-Exam Room	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
1008-2	Nurse's Office Bathroom	SK	App	6.86	3/2/2021	-	-	-	None	-	-	-
1008-3	Nurse's Office	SK	App	4.09	3/2/2021	-	-	-	None	-	-	-
1009-1	Room 134/135-Counter-Left	SK	App	1.57	3/2/2021	-	-	-	None	-	-	-
1009-2	Room 134/135-Counter-Right	SK	App	3.68	3/2/2021	-	-	-	None	-	-	-
1010-1	Room 136	WF	App	4.69	3/2/2021	-	-	-	None	-	-	-
1011-1	Hallway by Room 136	WF	App		3/2/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1012-1	Room 138-Counter @A	SK	App	4.77	3/2/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1012-2	Room 138-Counter @B	SK	App	2.39	3/2/2021	-	-	-	None	-	-	-
1012-3	Room 138-Counter @C	SK	App	2.61	3/2/2021	-	-	-	None	-	-	-
<b>1012-4</b>	<b>Room 138-Counter @C</b>	<b>SPY</b>	<b>App</b>	<b>31.4</b>	<b>3/2/2021</b>				<b>Additional Sampling Required</b>			
1012-5	Room 138-Counter @D	SK	App	3.4	3/2/2021	-	-	-	None	-	-	-
1013-1	Hallway by Room 138	WF	App	4.82	3/2/2021	-	-	-	None	-	-	-
1014-1	Room 139A-Counter @A	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
1014-2	Room 139A-Counter @B	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
1014-3	Room 139A-Counter @C	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
1014-4	Room 139A-Counter @D	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
1015-1	Hallway by Room 141	WF	App		3/2/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1016-1	Women's Bathroom by Room 139	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1017-1	Room 103	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1018-1	Men's Bathroom by Room 105	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1018-2	Men's Bathroom Custodial Closet	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1019-1	Boiler Room Bathroom	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1019-2	Boiler Room Work Shop	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1019-3	Boiler Room Electrical Shop	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
<b>1020-1</b>	<b>Room 117A</b>	<b>SK</b>	<b>App</b>	<b>17.5</b>	<b>3/2/2021</b>				<b>Additional Sampling Required</b>			
<b>1020-2</b>	<b>Room 117A Bathroom</b>	<b>SK</b>	<b>App</b>	<b>15.9</b>	<b>3/2/2021</b>				<b>Additional Sampling Required</b>			
1021-1	Hallway by Room 107	WF	App	<1.0	3/2/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1021-2	Hallway by Room 107	BF	App	<1.0	3/2/2021	-	-	-	None	-	-	-
1022-1	Room 110-Custodial Office	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1023-1	Hallway by Room 112	WF	App		3/2/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1024-1	Hallway by Room 114	WF	App		3/2/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
1025-1	Girl's Bathroom by New Gym @A	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1025-2	Girl's Bathroom by New Gym @B	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1025-3	Girl's Bathroom by New Gym @C	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1025-4	Girl's Bathroom by New Gym @D	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1025-5	Girl's Bathroom by New Gym @E	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1026-1	Custodial Closet by New Gym	SS	N/A		3/2/2021	-	-	-	None	LOCKED DOOR	-	-
1027-1	Girl's Locker Room by New Gym Bathroom @A	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1027-2	Girl's Locker Room by New Gym Bathroom @B	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1027-3	Girl's Locker Room by New Gym Bathroom @C	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1027-4	Girl's Locker Room Custodial Closet	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
1027-5	Girl's Locker Room Vestibule	WF	App		3/2/2021	-	-	-	Sampling Required	ONGOING RENOVATION	-	-
1027-6	Girl's Locker Room Vestibule	BF	App		3/2/2021	-	-	-	Sampling Required	ONGOING RENOVATION	-	-
1028-1	Boy's Locker Room by New Gym Bathroom @A	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1028-2	Boy's Locker Room by New Gym Bathroom @B	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1028-3	Boy's Locker Room by New Gym Bathroom @C	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1028-4	Boy's Locker Room Coach's Office Bathroom	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1028-5	Boy's Locker Room Vestibule	WF	App		3/2/2021	-	-	-	Sampling Required	ONGOING RENOVATION	-	-
1028-6	Boy's Locker Room Vestibule	BF	App		3/2/2021	-	-	-	Sampling Required	ONGOING RENOVATION	-	-
2001-1	Hallway by Room 223	WF	App	139	3/2/2021				Additional Sampling Required			
2002-1	Women's Bathroom by Room 228 @A	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2002-2	Women's Bathroom by Room 228 @B	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2002-3	Women's Bathroom by Room 228 @C	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2002-4	Women's Bathroom by Room 228 @D	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2002-5	Women's Bathroom by Room 228 @E	SK	N/A		3/2/2021	-	-	-	Mixed Valve Sign Required	-	-	-
2003-1	Custodial Closet by Room 228	SS	N/A		3/2/2021	-	-	-	None	LOCKED DOOR	-	-
2004-1	Men's Bathroom by Room 257	SK	N/A		3/2/2021	-	-	-	None	ONGOING RENOVATION	-	-
2005-1	Hallway by Room 220	WF	App		3/2/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2006-1	Boy's Bathroom by Room 216-Left	SK	App		3/2/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2006-2	Boy's Bathroom by Room 216-Right	SK	App	6.31	3/2/2021	-	-	-	None	-	-	-
2006-3	Boy's Bathroom Custodial Closet	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
2007-1	Hallway by Room 216	WF	App	<1.0	3/2/2021	-	-	-	None	-	-	-
2008-1	Main Office Middle School Kitchenette	SK	App	7.05	3/2/2021	-	-	-	None	-	-	-
2009-1	Men's Bathroom by Main Office @A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
2009-2	Men's Bathroom by Main Office @B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
2010-1	Security Office Bathroom	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
2011-1	Superintendent's Bathroom	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2012-1	Women's Bathroom by Superintendent's Office @A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
2012-2	Women's Bathroom by Superintendent's Office @B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
2013-1	Room 259 Bathroom-Left	SK	App	4.8	3/2/2021	-	-	-	None	-	-	-
2013-2	Room 259 Bathroom-Right	SK	App	1.82	3/2/2021	-	-	-	None	-	-	-
2014-1	Hallway by Room 246	WF	App		3/2/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2014-2	Hallway by Room 246	BF	App		3/2/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
2015-1	Girl's Bathroom by Room 246-Left	SK	App	4.94	3/2/2021	-	-	-	None	-	-	-
2015-2	Girl's Bathroom by Room 246-Right	SK	App	2.65	3/2/2021	-	-	-	None	-	-	-
2016-1	Hallway by Room 237	WF	App		3/2/2021	-	-	-	Sampling Required	ONGOING RENOVATION	-	-
2016-2	Hallway by Room 237	BF	App		3/2/2021	-	-	-	Sampling Required	ONGOING RENOVATION	-	-
2017-1	Custodial Closet by Room 237	SS	N/A		3/2/2021	-	-	-	None	ONGOING RENOVATION	-	-
3001-1	Hallway by Room 323	WF	App		3/2/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
3002-1	Room 323-Teacher's Station	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3002-2	Room 323-Counter @A	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3002-3	Room 323-Counter @B	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3002-4	Room 323-Counter @C	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3002-5	Room 323-Counter @D	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3002-6	Room 323-Counter @E	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3002-7	Room 323-Counter @F	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3002-8	Room 323-Prep Room	SK	App	5.55	3/2/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3003-1	Room 322-Teacher's Station	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3003-2	Room 322-Counter @A	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3003-3	Room 322-Counter @B	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3003-4	Room 322-Counter @C	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3003-5	Room 322-Counter @D	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3003-6	Room 322-Counter @E	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3003-7	Room 322-Counter @F	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3004-1	Girl's Bathroom by Room 329 @A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
3004-2	Girl's Bathroom by Room 329 @B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
3004-3	Girl's Bathroom by Room 329 @C	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
3004-4	Girl's Bathroom by Room 329 @D	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
3004-5	Girl's Bathroom by Room 329 @E	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
3005-1	Custodial Closet by Room 329	SS	N/A		3/2/2021	-	-	-	None	LOCKED DOOR	-	-
3006-1	Hallway by Room 331	WF	App		3/2/2021	-	-	-	Sampling Required	ONGOING RENOVATION	-	-
3006-2	Hallway by Room 331	BF	App		3/2/2021	-	-	-	Sampling Required	ONGOING RENOVATION	-	-
3007-1	Boy's Bathroom by Room 331	SK	N/A		3/2/2021	-	-	-	None	ONGOING RENOVATION	-	-
3008-1	Custodial Closet by Room 331	SS	N/A		3/2/2021	-	-	-	None	ONGOING RENOVATION	-	-
3009-1	Hallway by Room 321	WF	App		3/2/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
3010-1	Room 319-Teacher's Station	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3010-2	Room 319-Counter @A	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3010-3	Room 319-Counter @B	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3010-4	Room 319-Counter @C	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3010-5	Room 319-Counter @D	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3010-6	Room 319-Counter @E	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3010-7	Room 319-Counter @F	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3010-8	Room 319-Prep Room	SK	App	12	3/2/2021	-	-	-	None	-	-	-
3011-1	Boy's Bathroom by Room 317-Left	SK	App	2.62	3/2/2021	-	-	-	None	-	-	-
3011-2	Boy's Bathroom by Room 317-Right	SK	App	3.78	3/2/2021	-	-	-	None	-	-	-
3011-3	Boy's Bathroom Custodial Closet	SS	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
3012-1	Hallway by Room 317	WF	App		3/2/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
3013-1	Room 307-Teacher's Station	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3013-2	Room 307-Counter @A	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3013-3	Room 307-Counter @B	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3013-4	Room 307-Counter @C	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3013-5	Room 307-Counter @D	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3013-6	Room 307-Counter @E	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3013-7	Room 307-Counter @F	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3013-8	Room 307-Prep Room	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3014-1	Room 302-Teacher's Station	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3014-2	Room 302-Pod 1 @A	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3014-3	Room 302-Pod 2 @A	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3014-4	Room 302-Pod 3 @A	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3014-5	Room 302-Pod 4 @A	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3014-6	Room 302-Counter @A	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3014-7	Room 302-Counter @B	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
<b>3014-8</b>	<b>Room 302-Prep Room-Left</b>	<b>SK</b>	<b>App</b>	<b>35.8</b>	<b>3/2/2021</b>				<b>Additional Sampling Required</b>			
<b>3014-9</b>	<b>Room 302-Prep Room-Right</b>	<b>SK</b>	<b>App</b>	<b>63.9</b>	<b>3/2/2021</b>				<b>Additional Sampling Required</b>			
3015-1	Special Education Bathroom by Room 351	SK	App	6.4	3/2/2021	-	-	-	None	-	-	-
<b>3016-1</b>	<b>Special Education Room 351</b>	<b>SK</b>	<b>App</b>	<b>19.6</b>	<b>3/2/2021</b>				<b>Additional Sampling Required</b>			
3017-1	Hallway by Room 351	WF	App		3/2/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
3018-1	Room 353-Teacher's Station	SK	N/A		3/2/2021	-	-	-	None	SIGN	-	-
3018-2	Room 353-Counter @A	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
3018-3	Room 353-Counter @B	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
3018-4	Room 353-Counter @C	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
3018-5	Room 353-Counter @D	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
3018-6	Room 353-Counter @E	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
3018-7	Room 353-Counter @F	SK	N/A		3/2/2021	-	-	-	Sign Required	-	-	-
3019-1	Hallway by Room 340	WF	App		3/2/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
3019-2	Hallway by Room 340	BF	App		3/2/2021	-	-	-	None	REMOVED FROM SERVICE	-	-
3020-1	Girl's Bathroom by Room 340-Left	SK	App	5.14	3/2/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3020-2	Girl's Bathroom by Room 340-Right	SK	App	5.28	3/2/2021	-	-	-	None	-	-	-
3021-1	Room 341-Trough-Left	SK	App	3.09	3/2/2021	-	-	-	None	-	-	-
3021-2	Room 341-Trough-Right	SK	App	5.96	3/2/2021	-	-	-	None	-	-	-
3022-1	Room 316 Bathroom	SK	App	8.25	3/2/2021	-	-	-	None	-	-	-

**Laboratory Report**

NYE Report #: 2210880-17075

March 8, 2021

Project Manager  
Enviroscience Consultants, Inc.  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779

Project: Lawrence Middle School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on March 04, 2021. New York Environmental analyzed the samples on March 05, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



---

Li Tsang, Laboratory Director

Date Collected:	02 Mar 2021
Date Received:	04 Mar 2021
Date Analyzed:	05 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210304N048	1	LES Bathroom-SK; Initial	1.00	3.70	µg/L	
210304N049	2	Nurse's Office Bathroom-SK; Initial	1.00	6.86	µg/L	
210304N050	3	Nurse's Office-SK; Initial	1.00	4.09	µg/L	
210304N051	4	Room 134/135-Counter-Left-SK; Initial	1.00	1.57	µg/L	
210304N052	5	Room 134/135-Counter-Right-SK; Initial	1.00	3.68	µg/L	
210304N053	6	Room 136-WF; Initial	1.00	4.69	µg/L	
210304N054	7	Room 138-Counter @A-SK; Initial	1.00	4.77	µg/L	
210304N055	8	Room 138-Counter @B-SK; Initial	1.00	2.39	µg/L	
210304N056	9	Room 138-Counter @C-SK; Initial	1.00	2.61	µg/L	
210304N057	10	Room 138-Counter @C-SPY; Initial	1.00	31.4	µg/L	H
210304N058	11	Room 138-Counter @D-SK; Initial	1.00	3.40	µg/L	
210304N059	12	Hallway by Room 138-WF; Initial	1.00	4.82	µg/L	
210304N060	13	Room 117A-SK; Initial	1.00	17.5	µg/L	H
210304N061	14	Room 117A Bathroom-SK; Initial	1.00	15.9	µg/L	H
210304N062	15	Hallway by Room 107-WF; Initial	1.00	<1.00	µg/L	
210304N063	16	Hallway by Room 107-BF; Initial	1.00	<1.00	µg/L	
210304N064	17	Hallway by Room 223-WF; Initial	1.00	139	µg/L	E,H
210304N065	18	Boy's Bathroom by Room 216-Right-SK; Initial	1.00	6.31	µg/L	
210304N066	19	Hallway by Room 216-WF; Initial	1.00	<1.00	µg/L	
210304N067	20	Main Office Middle School Kitchenette-SK; Initial	1.00	7.05	µg/L	
210304N068	21	Room 259 Bathroom-Left-SK; Initial	1.00	4.80	µg/L	
210304N069	22	Room 259 Bathroom-Right-SK; Initial	1.00	1.82	µg/L	
210304N070	23	Girl's Bathroom by Room 246-Left-SK; Initial	1.00	4.94	µg/L	
210304N071	24	Girl's Bathroom by Room 246-Right-SK; Initial	1.00	2.65	µg/L	
210304N072	25	Room 323-Prep Room-SK; Initial	1.00	5.55	µg/L	
210304N073	26	Room 319-Prep Room-SK; Initial	1.00	12.0	µg/L	

Date Collected:	02 Mar 2021
Date Received:	04 Mar 2021
Date Analyzed:	05 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210304N074	27	Boy's Bathroom by Room 317-Left-SK; Initial	1.00	2.62	µg/L	
210304N075	28	Boy's Bathroom by Room 317-Right-SK; Initial	1.00	3.78	µg/L	
210304N076	29	Room 302-Prep Room-Left-SK; Initial	1.00	35.8	µg/L	H
210304N077	30	Room 302-Prep Room-Right-SK; Initial	1.00	63.9	µg/L	E,H
210304N078	31	Special Education Bathroom by Room 351-SK; Initial	1.00	6.40	µg/L	
210304N079	32	Special Education Room 351-SK; Initial	1.00	19.6	µg/L	H
210304N080	33	Girl's Bathroom by Room 340-Left-SK; Initial	1.00	5.14	µg/L	
210304N081	34	Girl's Bathroom by Room 340-Right-SK; Initial	1.00	5.28	µg/L	
210304N082	35	Room 341-Trough-Left-SK; Initial	1.00	3.09	µg/L	
210304N083	36	Room 341-Trough-Right-SK; Initial	1.00	5.96	µg/L	
210304N084	37	Room 316 Bathroom-SK; Initial	1.00	8.25	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

## Appendix C

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-1	Cafeteria A - Serving Area	SK	App	4.64	3/3/2021	-	-	-	None	-	-	-
0002-1	Basement Girl's Bathroom - Left	SK	App	22.1	3/3/2021				Additional Sampling Required			
0002-2	Basement Girl's Bathroom - Right	SK	App	17.6	3/3/2021				Additional Sampling Required			
0003-1	Basement Boy's Bathroom - Left	SK	App	31.7	3/3/2021				Additional Sampling Required			
0003-2	Basement Boy's Bathroom - Right	SK	App	10.1	3/3/2021	-	-	-	None	-	-	-
0004-1	Custodial Closet by Cafeteria B	SS	N/A		3/3/2021	-	-	-	Locked Door	-	-	-
0005-1	Hall by Cafeteria B	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
0006-1	Cafeteria B - Serving Area	SK	App	2.33	3/3/2021	-	-	-	None	-	-	-
0007-1	Room B9 - Left	SK	App	28.7	3/3/2021				Additional Sampling Required			
0007-2	Room B9 - Right	SK	App	25.6	3/3/2021				Additional Sampling Required			
0008-1	Hall by Basement Faculty Bathroom	WF	App	23.7	3/3/2021				Additional Sampling Required			
0009-1	Basement Faculty Bathroom	SK	App	13.6	3/3/2021	-	-	-	None	-	-	-
1001-1	Boy's Bathroom by Room 3	SK	App	21.9	3/3/2021				Additional Sampling Required			
1002-1	Hall by Room 1	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
1003-1	Girl's Bathroom by Room 1	SK	App	20.8	3/3/2021				Additional Sampling Required			
1004-1	Room 3	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
1004-2	Room 3	SK	App	17.5	3/3/2021				Additional Sampling Required			
1005-1	Principal's Office Bathroom	SK	N/A		3/3/2021	-	-	-	Sign Required	-	-	-
1006-1	Women's Faculty Bathroom by Room 7 - Left	SK	N/A		3/3/2021	-	-	-	Sign Required	-	-	-
1006-2	Women's Faculty Bathroom by Room 7 - Right	SK	N/A		3/3/2021	-	-	-	Sign Required	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1007-1	Nurse's Office	SK	App	2.4	3/3/2021	-	-	-	None	-	-	-
1008-1	Isolation Room Bathroom	SK	App	7.54	3/3/2021	-	-	-	None	-	-	-
1009-1	Hall by Room 8 - Left	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
1009-2	Hall by Room 8 - Right	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
1010-1	Custodial Closet by Room 8	SS	N/A		3/3/2021	-	-	-	Locked Door	-	-	-
1011-1	Boy's Bathroom by Room 12	SK	App	57.8	3/3/2021				Additional Sampling Required			
1012-1	Hall by Room 12	WF	App	10	3/3/2021	-	-	-	None	-	-	-
1013-1	Girl's Bathroom by Room 12	SK	App	18.6	3/3/2021				Additional Sampling Required			
1014-1	Room 30 Bathroom - Left	SK	App	40.6	3/3/2021				Additional Sampling Required			
1014-2	Room 30 Bathroom - Middle	SK	App	65.1	3/3/2021				Additional Sampling Required			
1014-3	Room 30 Bathroom - Right	SK	App	71.8	3/3/2021				Additional Sampling Required			
1015-1	PE Office Bathroom by Room 30	SK	N/A		3/3/2021	-	-	-	None	SIGN	-	-
1016-1	Hall by Gym Breezeway	WF	App	1.24	3/3/2021	-	-	-	None	-	-	-
1016-2	Hall by Gym Breezeway	BF	App	<1.0	3/3/2021	-	-	-	None	-	-	-
1017-1	Custodial Closet by Music Room	SS	N/A		3/3/2021	-	-	-	Locked Door	-	-	-
1018-1	Music Room Bathroom	SK	App	51.5	3/3/2021				Additional Sampling Required			
1019-1	PE Office Bathroom by Music Room	SK	N/A		3/3/2021	-	-	-	Sign Required	-	-	-
1020-1	Men's Bathroom by Gym Lobby - Left	SK	App	17.2	3/3/2021				Additional Sampling Required			
1020-2	Men's Bathroom by Gym Lobby - Right	SK	App	28.7	3/3/2021				Additional Sampling Required			
1021-1	Hall by Gym Lobby	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1022-1	Women's Bathroom by Gym Lobby - Left	SK	App	15.7	3/3/2021				Additional Sampling Required			
1022-2	Women's Bathroom by Gym Lobby - Right	SK	App	13	3/3/2021	-	-	-	None	-	-	-
1023-1	Custodial Closet by Gym Lobby	SS	N/A		3/3/2021	-	-	-	Locked Door	-	-	-
1024-1	Boy's Bathroom by Room 101 - Left	SK	App		3/3/2021	-	-	-	None	-	-	-
1024-2	Boy's Bathroom by Room 101 - Middle	SK	App	14.7	3/3/2021	-	-	-	None	-	-	-
1024-3	Boy's Bathroom by Room 101 - Right	SK	App	5.61	3/3/2021	-	-	-	None	-	-	-
1025-1	Girl's Bathroom by Room 102 - Left	SK	App	18.1	3/3/2021				Additional Sampling Required			
1025-2	Girl's Bathroom by Room 102 - Middle	SK	App	13.5	3/3/2021	-	-	-	None	-	-	-
1025-3	Girl's Bathroom by Room 102 - Right	SK	App	43	3/3/2021				Additional Sampling Required			
1026-1	Faculty Bathroom by Room 102	SK	N/A		3/3/2021	-	-	-	Sign Required	-	-	-
1027-1	Custodial Closet by Copy Room	SS	N/A		3/3/2021	-	-	-	Locked Door	-	-	-
1028-1	Copy Room	SK	App	12.1	3/3/2021	-	-	-	None	-	-	-
1029-1	Room 105	SK	App	3.73	3/3/2021	-	-	-	None	-	-	-
1030-1	Room 104	SK	App	1.71	3/3/2021	-	-	-	None	-	-	-
1031-1	Room 103	SK	App	5.6	3/3/2021	-	-	-	None	-	-	-
1032-1	Hall by Room 103	WF	App	<1.0	3/3/2021	-	-	-	None	-	-	-
1033-1	Room 102	SK	App	16	3/3/2021				Additional Sampling Required			
1034-1	Room 101	SK	App	3.57	3/3/2021	-	-	-	None	-	-	-
2001-1	Boy's Bathroom by Room 17	SK	App	21.9	3/3/2021				Additional Sampling Required			
2002-1	Hall by Room 15	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2003-1	Girl's Bathroom by Room 15	SK	App	20.8	3/3/2021				Additional Sampling Required			
2004-1	Room 17	SK	App		3/3/2021	-	-	-	None	Removed From Service	-	-
2005-1	Hall by Room 21	WF	App	<1.0	3/3/2021	-	-	-	None	-	-	-
2006-1	Psychology Office Bathroom	SK	N/A		3/3/2021	-	-	-	Sign Required	-	-	-
2007-1	Room 22B	SK	App	11	3/3/2021	-	-	-	None	-	-	-
2007-2	Room 22B	SPY	App		3/3/2021	-	-	-	None	Removed From Service	-	-
2007-3	Room 22B Bathroom	SK	App	12.8	3/3/2021	-	-	-	None	-	-	-
2008-1	Hall by Room 22B - Left	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
2008-2	Hall by Room 22B - Right	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
2009-1	Custodial Closet by Room 22	SS	N/A		3/3/2021	-	-	-	Locked Door	-	-	-
2010-1	Boy's Bathroom by Room 26	SK	App	39.5	3/3/2021				Additional Sampling Required			
2011-1	Hall by Room 26	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
2012-1	Girl's Bathroom by Room 26	SK	App	25.2	3/3/2021				Additional Sampling Required			

**Laboratory Report (Revised)**

NYE Report #: 2210879-17074R

March 9, 2021

Project Manager  
Enviroscience Consultants, Inc.  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779

Project: Lawrence School No. 2

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on March 04, 2021. New York Environmental analyzed the samples on March 05, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



---

Li Tsang, Laboratory Director

Date Collected:	03 Mar 2021
Date Received:	04 Mar 2021
Date Analyzed:	05 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210304N001	1	Cafeteria A - Serving Area-SK; Initial	1.00	4.64	µg/L	
210304N002	2	Basement Girl's Bathroom - Left-SK; Initial	1.00	22.1	µg/L	H
210304N003	3	Basement Girl's Bathroom - Right-SK; Initial	1.00	17.6	µg/L	H
210304N004	4	Basement Boy's Bathroom - Left-SK; Initial	1.00	31.7	µg/L	H
210304N005	5	Basement Boy's Bathroom - Right-SK; Initial	1.00	10.1	µg/L	
210304N006	6	Cafeteria B - Serving Area-SK; Initial	1.00	2.33	µg/L	
210304N007	7	Room B9 - Left-SK; Initial	1.00	28.7	µg/L	H
210304N008	8	Room B9 - Right-SK; Initial	1.00	25.6	µg/L	H
210304N009	9	Basement Faculty Bathroom-SK; Initial	1.00	13.6	µg/L	
210304N010	10	Hall by Basement Faculty Bathroom-WF; Initial	1.00	23.7	µg/L	H
210304N011	11	Boy's Bathroom by Room 17-SK; Initial	1.00	21.9	µg/L	H
210304N012	12	Girl's Bathroom by Room 15-SK; Initial	1.00	20.8	µg/L	H
210304N013	13	Hall by Room 21-WF; Initial	1.00	<1.00	µg/L	
210304N014	14	Room 22B-SK; Initial	1.00	11.0	µg/L	
210304N015	15	Room 22B Bathroom-SK; Initial	1.00	12.8	µg/L	
210304N016	16	Boy's Bathroom by Room 26-SK; Initial	1.00	39.5	µg/L	H
210304N017	17	Girl's Bathroom by Room 26-SK; Initial	1.00	25.2	µg/L	H
210304N018	18	Boy's Bathroom by Room 3-SK; Initial	1.00	14.8	µg/L	
210304N019	19	Girl's Bathroom by Room 1-SK; Initial	1.00	10.9	µg/L	
210304N020	20	Room 3-SK; Initial	1.00	17.5	µg/L	H
210304N021	21	Nurse's Office-SK; Initial	1.00	2.40	µg/L	
210304N022	22	Isolation Room Bathroom-SK; Initial	1.00	7.54	µg/L	
210304N023	23	Boy's Bathroom by Room 12-SK; Initial	1.00	57.8	µg/L	E,H
210304N024	24	Hall by Room 12-WF; Initial	1.00	10.0	µg/L	
210304N025	25	Girl's Bathroom by Room 12-SK; Initial	1.00	18.6	µg/L	H
210304N026	26	Room 30 Bathroom - Left-SK; Initial	1.00	40.6	µg/L	H



Date Collected:	03 Mar 2021
Date Received:	04 Mar 2021
Date Analyzed:	05 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210304N027	27	Room 30 Bathroom - Middle-SK; Initial	1.00	65.1	µg/L	E,H
210304N028	28	Room 30 Bathroom - Right-SK; Initial	1.00	71.8	µg/L	E,H
210304N029	29	Hall by Gym Breezeway-WF; Initial	1.00	1.24	µg/L	
210304N030	30	Hall by Gym Breezeway-BF; Initial	1.00	<1.00	µg/L	
210304N031	31	Music Room Bathroom-SK; Initial	1.00	51.5	µg/L	E,H
210304N032	32	Men's Bathroom by Gym Lobby - Left-SK; Initial	1.00	17.2	µg/L	H
210304N033	33	Men's Bathroom by Gym Lobby - Right-SK; Initial	1.00	28.7	µg/L	H
210304N034	34	Women's Bathroom by Gym Lobby - Left-SK; Initial	1.00	15.7	µg/L	H
210304N035	35	Women's Bathroom by Gym Lobby - Right-SK; Initial	1.00	13.0	µg/L	
210304N036	36	Boy's Bathroom by Room 101 - Middle-SK; Initial	1.00	14.7	µg/L	
210304N037	37	Boy's Bathroom by Room 101 - Right-SK; Initial	1.00	5.61	µg/L	
210304N038	38	Girl's Bathroom by Room 102 - Left-SK; Initial	1.00	18.1	µg/L	H
210304N039	39	Girl's Bathroom by Room 102 - Middle-SK; Initial	1.00	13.5	µg/L	
210304N040	40	Girl's Bathroom by Room 102 - Right-SK; Initial	1.00	43.0	µg/L	H
210304N041	41	Copy Room-SK; Initial	1.00	12.1	µg/L	
210304N042	42	Room 105-SK; Initial	1.00	3.73	µg/L	
210304N043	43	Room 104-SK; Initial	1.00	1.71	µg/L	
210304N044	44	Room 103-SK; Initial	1.00	5.60	µg/L	
210304N045	45	Hall by Room 103-WF; Initial	1.00	<1.00	µg/L	
210304N046	46	Room 102-SK; Initial	1.00	16.0	µg/L	H
210304N047	47	Room 101-SK; Initial	1.00	3.57	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Revision History:

Report revised on 3/9/2021, replaces report generated on 3/8/2021.

- Sample descriptions updated as per chain of custody.



## Appendix D

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-1	Room B13	SK	App	42.3	3/3/2021				Additional Sampling Required	Permanent Sign Posted		
0002-1	Cafeteria - B14/B16	SK	App		3/3/2021	-	-	-	None	Removed From Service	-	-
0003-1	Boy's Bathroom by Cafeteria	SK	App		3/3/2021	-	-	-	None	Removed From Service	-	-
0003-2	Boy's Bathroom by Cafeteria	SS	N/A		3/3/2021	-	-	-	Sign Required	-	-	-
0004-1	Girl's Bathroom by Cafeteria - Left	SK	App	28.3	3/3/2021				Additional Sampling Required			
0004-2	Girl's Bathroom by Cafeteria - Right	SK	App		3/3/2021	-	-	-	None	Removed From Service	-	-
0005-1	Pre-K Lunch Room	SK	App	26.7	3/3/2021				Additional Sampling Required			
0006-1	Hallway by Pre-K Lunch Room - Left	WF	App		3/3/2021	-	-	-	None	-	-	-
0007-1	Hallway by Pre-K Lunch Room - Right	WF	App		3/3/2021	-	-	-	None	-	-	-
0007-1	Unisex Bathroom by Pre-K Lunch Room - Left	SK	App	29.6	3/3/2021				Additional Sampling Required			
0007-2	Unisex Bathroom by Pre-K Lunch Room - Right	SK	App	15.7	3/3/2021				Additional Sampling Required			
0008-1	Room B9 - Left	SK	App	5.24	3/3/2021	-	-	-	None	-	-	-
0008-2	Room B9 - Right	SK	App	23.3	3/3/2021				Additional Sampling Required			
0009-1	Custodial Office	SS	N/A		3/3/2021	-	-	-	Sign Required	-	-	-
0009-2	Custodial Office Bathroom	SK	N/A		3/3/2021	-	-	-	Sign Required	-	-	-
0010-1	Room B3	SK	App		3/3/2021	-	-	-	None	Removed From Service	-	-
0012-1	Hallway by Room B3	WF	App	1.23	3/3/2021	-	-	-	None	-	-	-
0012-1	Unisex Bathroom by Room B3 - Left	SK	App	6.92	3/3/2021	-	-	-	None	-	-	-
0012-2	Unisex Bathroom by Room B3 - Right	SK	App	9.82	3/3/2021	-	-	-	None	-	-	-
1001-1	Room 13	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-2	Room 13 Bathroom	SK	App	3.55	3/3/2021	-	-	-	None	-	-	-
<b>1002-1</b>	<b>Room 14</b>	<b>WF</b>	<b>App</b>	<b>72</b>	<b>3/3/2021</b>				<b>Additional Sampling Required</b>			
1002-2	Room 14 Bathroom	SK	App	9.23	3/3/2021	-	-	-	None	-	-	-
1003-1	Unisex Bathroom	SS	N/A		3/3/2021	-	-	-	Sign Required	-	-	-
1004-1	Unisex Bathroom	SK	N/A		3/3/2021	-	-	-	Sign Required	-	-	-
1004-1	Hallway by Room 14 - Left	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
1004-2	Hallway by Room 14 - Right	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
1005-1	Faculty Bathroom by Room 12	SK	N/A		3/3/2021	-	-	-	Sign Required	-	-	-
<b>1006-1</b>	<b>Room 12</b>	<b>SK</b>	<b>App</b>	<b>28.1</b>	<b>3/3/2021</b>				<b>Additional Sampling Required</b>			
1006-2	Room 12	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
1007-1	Room 11	WF	App	7.06	3/3/2021	-	-	-	None	-	-	-
1007-2	Room 11 Bathroom	SK	App	8.93	3/3/2021	-	-	-	None	-	-	-
1008-2	Room 10	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
1008-2	Room 10 Bathroom	SK	App	6.15	3/3/2021	-	-	-	None	-	-	-
<b>1009-1</b>	<b>Room 9</b>	<b>WF</b>	<b>App</b>	<b>17.6</b>	<b>3/3/2021</b>				<b>Additional Sampling Required</b>			
1009-2	Room 9 Bathroom	SK	App	3.22	3/3/2021	-	-	-	None	-	-	-
1010-1	Supervisor's Office Bathroom	SK	N/A		3/3/2021	-	-	-	Sign Required	-	-	-
1011-1	Nurse's Office	SK	App	9.79	3/3/2021	-	-	-	None	-	-	-
<b>1011-2</b>	<b>Nurse's Office Bathroom</b>	<b>SK</b>	<b>App</b>	<b>36.4</b>	<b>3/3/2021</b>				<b>Additional Sampling Required</b>			
1012-1	Room 7 Bathroom	SK	App	5.62	3/3/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1013-2	Room 6	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
1013-2	Room 6 Bathroom	SK	App	2.04	3/3/2021	-	-	-	None	-	-	-
1014-1	Room 5	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
<b>1014-2</b>	<b>Room 5 Bathroom</b>	<b>SK</b>	<b>App</b>	<b>83</b>	<b>3/3/2021</b>				<b>Additional Sampling Required</b>			
<b>1015-1</b>	<b>Room 4</b>	<b>SK</b>	<b>App</b>	<b>43.4</b>	<b>3/3/2021</b>				<b>Additional Sampling Required</b>			
1015-2	Room 4 Bathroom	SK	App	9.61	3/3/2021	-	-	-	None	-	-	-
1016-1	Room 3	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
1016-2	Room 3 Bathroom	SK	App	4.69	3/3/2021	-	-	-	None	-	-	-
1018-1	Faculty Bathroom by Room 3	SK	App	7.64	3/3/2021	-	-	-	None	-	-	-
1018-1	Hallway by Room 1 - Left	WF	App	<1.0	3/3/2021	-	-	-	None	-	-	-
1018-2	Hallway by Room 1 - Right @A	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
1018-3	Hallway by Room 1 - Right @B	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
1019-1	Room 2 Bathroom	SK	App	1.2	3/3/2021	-	-	-	None	-	-	-
1020-1	Room 1 Bathroom	SK	App	3.18	3/3/2021	-	-	-	None	-	-	-
1020-2	Room 1 Storage Closet	SK	App	4.4	3/3/2021	-	-	-	None	-	-	-
1021-1	Unisex Bathroom by Room 1	SS	N/A		3/3/2021	-	-	-	Sign Required	-	-	-
2001-1	Unisex Bathroom by Room 2	SK	N/A		3/3/2021	-	-	-	Sign Required	-	-	-
2001-1	Room 23 Bathroom	SK	App	9.86	3/3/2021	-	-	-	None	-	-	-
<b>2002-1</b>	<b>Room 24 Bathroom</b>	<b>SK</b>	<b>App</b>	<b>22.1</b>	<b>3/3/2021</b>				<b>Additional Sampling Required</b>			
2003-1	Room 25 Bathroom	SK	App	3.33	3/3/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2004-1	Room 26	SK	App	1	3/3/2021	-	-	-	None	-	-	-
2004-2	Room 26	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
2005-1	Faculty Bathroom by Room 26	SK	App	2.78	3/3/2021	-	-	-	None	-	-	-
2006-1	Hallway by Room 28 - Left @A	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
2006-3	Hallway by Room 28 - Left @B	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
2006-3	Hallway by Room 28 - Right	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
2007-1	Unisex Bathroom	SS	N/A		3/3/2021	-	-	-	Sign Required	-	-	-
2007-2	Unisex Bathroom	SK	N/A		3/3/2021	-	-	-	Sign Required	-	-	-
2008-1	Room 27 Bathroom	SK	App	<1.0	3/3/2021	-	-	-	None	-	-	-
2009-1	Room 28	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
2009-2	Room 28 Bathroom	SK	App	4.25	3/3/2021	-	-	-	None	-	-	-
2010-1	Room 22 Bathroom	SK	App	7.28	3/3/2021	-	-	-	None	-	-	-
2011-2	Faculty Lunch Room Kitchenette	SK	App	5.2	3/3/2021	-	-	-	None	-	-	-
2011-2	Faculty Lunch Room Bathroom	SK	App	12.7	3/3/2021	-	-	-	None	-	-	-
2012-1	Room 21	SK	App		3/3/2021	-	-	-	None	Removed From Service	-	-
2013-1	Room 20 Bathroom	SK	App	3.54	3/3/2021	-	-	-	None	-	-	-
2014-1	Room 19	SK	App		3/3/2021	-	-	-	None	Removed From Service	-	-
<b>2014-2</b>	<b>Room 19 Bathroom</b>	<b>SK</b>	<b>App</b>	<b>45.4</b>	<b>3/3/2021</b>				<b>Additional Sampling Required</b>			
2015-1	Room 18 Bathroom	SK	App	5.46	3/3/2021	-	-	-	None	-	-	-
2016-1	Room 17 Bathroom	SK	App	8.74	3/3/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2018-1	Faculty Bathroom by Room 17	SK	App	2.53	3/3/2021	-	-	-	None	-	-	-
2018-1	Hallway by Library - Left @A	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
2018-2	Hallway by Library - Left @B	WF	App		3/3/2021	-	-	-	None	Removed From Service	-	-
2018-3	Hallway by Library - Right	WF	App	1.83	3/3/2021	-	-	-	None	-	-	-
2019-1	Library Bathroom	SK	App	5.35	3/3/2021	-	-	-	None	-	-	-

## Laboratory Report

NYE Report #: 2210881-17076

March 8, 2021

Project Manager  
Enviroscience Consultants, Inc.  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779

Project: Lawrence School No. 4

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on March 04, 2021. New York Environmental analyzed the samples on March 05, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



---

Li Tsang, Laboratory Director

Date Collected:	03 Mar 2021
Date Received:	04 Mar 2021
Date Analyzed:	05 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210304N085	1	Room 13 Bathroom-SK; Initial	1.00	3.55	µg/L	
210304N086	2	Room 14-SK; Initial	1.00	72.0	µg/L	E,H
210304N087	3	Room 14 Bathroom-SK; Initial	1.00	9.23	µg/L	
210304N088	4	Faculty Bathroom by Room 12-SK; Initial	1.00	3.19	µg/L	
210304N089	5	Room 12-SK; Initial	1.00	28.1	µg/L	H
210304N090	6	Room 11-WF; Initial	1.00	7.06	µg/L	
210304N091	7	Room 11 Bathroom-SK; Initial	1.00	8.93	µg/L	
210304N092	8	Room 10 Bathroom-SK; Initial	1.00	6.15	µg/L	
210304N093	9	Room 9-WF; Initial	1.00	17.6	µg/L	H
210304N094	10	Room 9 Bathroom-SK; Initial	1.00	3.22	µg/L	
210304N095	12	Nurse's Office-SK; Initial	1.00	9.79	µg/L	
210304N096	13	Nurse's Office Bathroom-SK; Initial	1.00	36.4	µg/L	H
210304N097	14	Room 7 Bathroom-SK; Initial	1.00	5.62	µg/L	
210304N098	15	Room 6 Bathroom-SK; Initial	1.00	2.04	µg/L	
210304N099	16	Room 5 Bathroom-SK; Initial	1.00	83.0	µg/L	E,H
210304N100	17	Room 4-SK; Initial	1.00	43.4	µg/L	H
210304N101	18	Room 4 Bathroom-SK; Initial	1.00	9.61	µg/L	
210304N102	19	Room 3 Bathroom-SK; Initial	1.00	4.69	µg/L	
210304N103	20	Faculty Bathroom by Room 3-SK; Initial	1.00	7.64	µg/L	
210304N104	21	Hallway by Room 1 - Left-WF; Initial	1.00	<1.00	µg/L	
210304N105	22	Room 2 Bathroom-SK; Initial	1.00	1.20	µg/L	
210304N106	23	Room 1 Bathroom-SK; Initial	1.00	3.18	µg/L	
210304N107	24	Room 1 Storage Closet-SK; Initial	1.00	4.40	µg/L	
210304N108	25	Room 23 Bathroom-SK; Initial	1.00	9.86	µg/L	
210304N109	26	Room 24 Bathroom-SK; Initial	1.00	22.1	µg/L	H
210304N110	27	Room 25 Bathroom-SK; Initial	1.00	3.33	µg/L	



Date Collected:	03 Mar 2021
Date Received:	04 Mar 2021
Date Analyzed:	05 Mar 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210304N111	28	Room 26-WF; Initial	1.00	1.00	µg/L	
210304N112	29	Faculty Bathroom by Room 26-SK; Initial	1.00	2.78	µg/L	
210304N113	30	Room 27 Bathroom-SK; Initial	1.00	<1.00	µg/L	
210304N114	31	Room 28 Bathroom-SK; Initial	1.00	4.25	µg/L	
210304N115	32	Room 22 Bathroom-SK; Initial	1.00	7.28	µg/L	
210304N116	33	Faculty Lunch Room Kitchenette-SK; Initial	1.00	5.20	µg/L	
210304N117	34	Faculty Lunch Room Bathroom-SK; Initial	1.00	12.7	µg/L	
210304N118	35	Room 20 Bathroom-SK; Initial	1.00	3.54	µg/L	
210304N119	36	Room 19 Bathroom-SK; Initial	1.00	45.4	µg/L	H
210304N120	37	Room 18 Bathroom-SK; Initial	1.00	5.46	µg/L	
210304N121	38	Room 17 Bathroom-SK; Initial	1.00	8.74	µg/L	
210304N122	39	Faculty Bathroom by Room 17-SK; Initial	1.00	2.53	µg/L	
210304N123	40	Hallway by Library - Right-WF; Initial	1.00	1.83	µg/L	
210304N124	41	Library Bathroom-SK; Initial	1.00	5.35	µg/L	
210304N125	42	Room B13-SK; Initial	1.00	42.3	µg/L	H
210304N126	43	Girl's Bathroom by Cafeteria - Left-SK; Initial	1.00	28.3	µg/L	H
210304N127	44	Pre-K Lunch Room-SK; Initial	1.00	26.7	µg/L	H
210304N128	45	Unisex Bathroom by Pre-K Lunch Room - Left-SK; Initial	1.00	29.6	µg/L	H
210304N129	46	Unisex Bathroom by Pre-K Lunch Room - Right-SK; Initial	1.00	15.7	µg/L	H
210304N130	47	Room B9 - Left-SK; Initial	1.00	5.24	µg/L	
210304N131	48	Room B9 - Right-SK; Initial	1.00	23.3	µg/L	H
210304N132	49	Hallway by Room B3-WF; Initial	1.00	1.23	µg/L	
210304N133	50	Unisex Bathroom by Room B3 - Left-SK; Initial	1.00	6.92	µg/L	
210304N134	51	Unisex Bathroom by Room B3 - Right-SK; Initial	1.00	9.82	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

